

T-385
Chenar Farm
9284 Chenar Farm Road
Easton Vicinity
Ca. 1922-1923
Private

Chenar Farm is a gentleman's farm located on 95.50 acres of land on the banks of the Miles River, to the west of the community of Easton in Talbot County, Maryland and contains eighteen structures. The structures include a residence, boathouse, tool shed, powerhouse, cook's house, smokehouse, carriage house, garage, dairy barn, corncrib, animal shed, stable, silo, three tenant houses, gas house, and a machine shed.

The property known as Chenar Farm, also known variously as "Bennett's Neglect," "Mackay Farm," and "Sycamores," represents an intact collection of agricultural buildings associated with the historically important trend of the gentleman farmer and the development of the dairy industry in Talbot County. The property was purchased by James M. and Lida A. Cowgill in 1891 from Sarah A. Mackey, F. Eugenia Smith, and her husband, Sidney W. Smith. The Cowgills sold the property to Winfield Scott Way and his wife Kate A. in 1908, who owned the property until 1914 when it was purchased by Louis A. and Amanda J. Hazard. The Hazards sold the farm to Ernst Puttkammer in 1917. Henry F. DePuy purchased the property from Ernst Puttkammer and his wife in 1919 and began construction of the house, grounds, and agricultural buildings found on the property today. Mr. DePuy utilized earlier residences remaining on the property as tenant houses. The trustee of the DePuy Estate sold the property to Lela Bartlett Hughes in 1925. The property has remained within the Hughes family since that time.

Maryland Historical Trust Maryland Inventory of Historic Properties Form

Inventory No. T-385

1. Name of Property

historic Chenar Farm
other Bennett's Neglect; Mackay Farm; Sycamores

2. Location

street and number 9284 Chenar Farm Road N/A not for publication
city, town Easton X vicinity
county Talbot

3. Owner of Property (give names and mailing addresses of all owners)

name Thomas R. Hughes, Jr.
street and number 9284 Chenar Farm Road telephone 410-822-0454
city, town Easton state MD zip code 21601

4. Location of Legal Description

courthouse, registry of deeds, etc. Talbot County Courthouse liber 496 folio 598 and liber 479 folio 249
city, town Easton tax map 24/11 tax parcel 37 tax ID number 036092

5. Primary Location of Additional Data

- Contributing Resource in National Register District
 Contributing Resource in Local Historic District
 Determined Eligible for the National Register/Maryland Register
 Determined Ineligible for the National Register/Maryland Register
 Recorded by HABS/HAER
 Historic Structure Report or Research Report at MHT
 Other: _____

6. Classification

Category	Ownership	Current Function	Resource Count
<input type="checkbox"/> district	<input type="checkbox"/> public	<input checked="" type="checkbox"/> agriculture	Contributing
<input checked="" type="checkbox"/> building(s)	<input checked="" type="checkbox"/> private	<input type="checkbox"/> commerce/trade	<u>16</u>
<input type="checkbox"/> structure	<input type="checkbox"/> both	<input type="checkbox"/> defense	Noncontributing
<input type="checkbox"/> site		<input checked="" type="checkbox"/> domestic	<u>1</u>
<input type="checkbox"/> object		<input type="checkbox"/> education	<u>17</u>
		<input type="checkbox"/> funerary	<u>1</u>
		<input type="checkbox"/> government	Total
		<input type="checkbox"/> health care	<u>0</u>
		<input type="checkbox"/> industry	
		<input type="checkbox"/> landscape	
		<input type="checkbox"/> recreation/culture	
		<input type="checkbox"/> religion	
		<input type="checkbox"/> social	
		<input type="checkbox"/> transportation	
		<input type="checkbox"/> work in progress	
		<input type="checkbox"/> unknown	
		<input type="checkbox"/> vacant/not in use	
		<input type="checkbox"/> other:	
			Number of Contributing Resources previously listed in the Inventory
			<u>0</u>

7. Description

Inventory No. T-385

Condition

excellent deteriorated
 good ruins
 fair altered

Prepare both a one paragraph summary and a comprehensive description of the resource and its various elements as it exists today.

Summary Description

Chenar Farm is located on 95.50 acres of land on the banks of the Miles River, to the west of the community of Easton in Talbot County, Maryland and contains eighteen structures. The structures include a residence, boathouse, tool shed, powerhouse, cook's house, smokehouse, carriage house, garage, dairy barn, corncrib, animal shed, stable, silo, three tenant houses, gas house, and a machine shed.

The main residence is located approximately one-eighth of a mile down a straight gravel access road. The agricultural buildings are located on the north side of the access road and are arranged in a linear plan that forms a square farmyard. The domestic outbuildings are located adjacent to the main residence. A ca. 1910 tenant house is located on the northern side of the road, closest to the main house. A ca. 1930 tenant house is located directly to the northwest of tenant house #1 and is separated from the main complex by cultivated agricultural fields and trees. A ca. 1890 tenant house is located furthest from the main house and northeast of tenant house #2. The property is surrounded by cultivated agricultural fields and water. The property is an active farm.

The landscaping was designed by J. Franklin Meehan & Son, a landscape architecture firm with offices located in Mt. Airy, Maryland and Philadelphia, Pennsylvania. The plan called for the property to be approached down a long road lined with sycamores, and with the main house at the end of the drive with a circular driveway and grassy circle in the front. Between the main house and the Miles River, the land gently slopes with specimen plantings. Gardens were to be located to the south of the house. The original plans also called for a formal flower garden, arbors for roses and vines, a berry garden, a vegetable garden, and grape vines. The landscape plan was followed closely, with the exception of the garden area. The formal garden was developed in its intended location, but there are no traces of the planned arbors, berry garden, vegetable garden, or grape vines. In the intended vegetable garden location a second formal garden was planted. The areas away from the main house were left as grassy fields, with deciduous trees planted as windbreaks and view screens. The house, tool house, powerhouse, and tenant house #1 are located amongst dense overgrowth.

Main House, ca. 1923

The main house is a two-and-a-half story wood frame structure with a two-story south side wing and a one-story north side wing, built ca. 1923. The residence was designed by Frank Ross, an Easton architect. The side wings are part of the original design. The building rests on a continuous brick masonry foundation and has a central passage, double-pile plan. The hipped roof with large overhanging eaves is clad with asphalt shingles and has four hipped roof dormers with 8-pane hopper sashes. Two dormers are located on each of the front and rear façades. There are two exterior end gable brick masonry chimneys.

The west façade is the principle building entry and faces the entry drive. The walls are clad with wood shingles. The building is entered through a central hinged four panel wood front door with fifteen-light sidelights. The side entry doors are hinged five panel wood doors. The windows are a combination of six-over-one and eight-over-one wood sashes. The front entry porch has a poured concrete floor, two fluted wood Doric columns, and a front-gable roof clad with asphalt shingles.

The north façade is clad with wood shingles. The windows are eight-over-one wood sashes. The windows on the wing are grouped in threes. There are no doors on this façade.

The east façade of the house is the secondary entry and faces the Miles River. The walls are clad with wood shingles. The building is entered through a central hinged four panel wood door with fifteen-light sidelights. The side entry doors are hinged five panel wood doors. The windows are a combination of six-over-one and eight-over-one wood sashes with an elliptical window on the second level. A bay window is located on the north end of the second story. The rear entry porch has a poured concrete floor, two fluted wood Doric columns, and a front-gable roof clad with asphalt shingles.

Maryland Historical Trust

Maryland Inventory of Historic Properties Form

Inventory No. T-385

Chenar Farm
Continuation Sheet

Number 7 Page 1

The south façade is clad with wood shingles. The side entry door is a hinged four panel one-light wood door. The windows are six-over-one wood sashes with one six-over-six vinyl replacement units.

The interior has six rooms on the first floor and eight rooms on the second floor. The floors are of wood planks with an open string staircase to the upper levels. The walls and ceiling are of plaster with a simple plaster cornice running through all rooms.

There are five domestic outbuildings: a boathouse, tool shed, powerhouse, cook's house, and smokehouse.

Boathouse, ca. 1923

The boathouse is located at the end of a wood dock and is a one-story wood frame structure with an undivided interior space. The building rests on wood piers sunk into the river bottom. The walls are clad with six inch vertical wood planks. The side gable roof is clad with standing-seam metal. The building is accessed through a hinged wood plank door on the north façade. There are no windows. The interior of the building is unfinished with a wood plank floor.

Tool House, ca. 1923

The tool house is a one-story wood frame structure with an undivided interior space. The building rests on a continuous brick foundation. The walls are clad with horizontal wood planks. The low-pitched hipped roof with large overhanging eaves is clad with standing-seam metal. The building is accessed through a hinged wood plank door on the east façade. The windows are six-pane wood hopper sashes. The interior of the building is unfinished with a wood plank floor.

Powerhouse, ca. 1923

The powerhouse is a two-story wood frame structure with a double pen plan. The building rests on a continuous brick foundation. The walls are clad with wood shingles. The clipped gable roof with is clad with asphalt shingles. The front and side entries have hinged two panel one-light wood doors on the north and west façades. The basement entry has a pair of hinged wood plank cellar doors. The windows are six-over-six wood sashes, with an arched six-over-six wood sash on the gable ends. The interior walls and ceiling are clad with beadboard. The interior has a wood plank floor and open wood stair to the second level. A wood frame greenhouse was originally attached to the rear of the building, but was removed due to deterioration ca. 1980.

Cook's House/ Help's Quarters, ca. 1923

The building known as the Cook's House, or the Help's Quarters, is a two-story wood frame structure with an undivided interior space, originally used as a residence for the domestic help. The building rests on a continuous brick foundation. The walls are clad with board and batten. The front-gable roof is clad with asphalt shingles. The building is accessed through a hinged wood plank door on the east façade. The windows are six-over-six wood sashes and six-pane wood hopper sashes. The building has an exterior side wall brick masonry chimney. A one seat privy with a shed roof is located on the north façade. The interior walls and ceiling are clad with beadboard. A portion of the building has been removed.

Smokehouse, date unknown

The smokehouse is a one-story timber frame structure with an undivided interior space. The building rests on a continuous poured concrete foundation. The walls are clad with six inch vertical wood planks. The front-gable roof is clad with standing-seam metal. Ventilators are located on the gable ends. The building is accessed through a hinged wood plank door on the east façade. There are no windows. The interior of the building is unfinished with an earthen floor. The building has been moved to its current location from elsewhere on the property.

Maryland Historical Trust

Maryland Inventory of Historic Properties Form

Inventory No. T-385

Chenar Farm
Continuation Sheet

Number 7 Page 2

The agricultural complex consists of seven structures: a carriage house, garage, dairy barn, corncrib, animal shed, stable, and silo.

Carriage House, ca. 1922

The carriage house, constructed ca. 1922, is three bays wide and is of timber frame construction with open entries on the north and south façades. The easternmost bay is a storage room. The structure rests on a continuous combination brick and poured concrete foundation. The walls are clad with beveled wood siding. The cross gambrel roof with clipped gable ends is clad with standing-seam metal and has a cupola at the intersection. The doors are hinged four panel wood doors with sliding Dutch doors on the side façades. The front hayloft door is arched. The windows are six-over-six wood sashes. The interior of the building is unfinished with an earthen floor in one bay, poured concrete in the second bay, and a wood plank floor in the third bay. The walls of the third bay are clad with wood planks.

Dairy Barn, ca. 1922

The dairy barn, constructed ca. 1922, is three bays deep and is of timber frame construction with a one-story milk house rear addition. The structure rests on a continuous poured concrete foundation. The walls are clad with beveled wood siding. The front-gable roof is clad with corrugated metal and has a cupola. The doors are hinged wood planks with diagonal bracing. The windows are two-pane steel hopper sashes. The interior of the building is unfinished with a poured concrete floor. Original plans of the barn in the possession of the current owner indicate that the barn was designed by the Extension Service, University of Maryland, Division of Agricultural Engineering, and that the design was either a free or low cost plan.

Corncrib, ca. 1922

The corncrib, constructed ca. 1922, is a one-story round structure with a metal frame constructed by the Iron Crib and Bin Company of Wooster, Ohio and has a 1909 patent date. The structure rests on a continuous poured concrete foundation. The walls are clad with pierced steel panels bolted together. The conical roof is clad with standing-seam metal. The door is a pierced steel panel. There are no windows. The interior of the building is unfinished with a poured concrete floor.

Animal Shed/ Stable, ca. 1922 and 1960

The ten-bay animal shed and stable are connected structures that form an "L" shape. The stables are located on the eastern end. A portion of the southern end of the animal shed was enclosed in the 1960s and converted into a hen house. The animal shed rests on a poured concrete pier foundation. The walls are clad with six inch vertical wood plank siding. The shed roof is clad with standing-seam metal. The doors are hinged wood planks with diagonal bracing. The windows are four-pane wood fixed sashes. The interior of the building is unfinished with an earthen floor. The stable portion rests on a poured concrete pier foundation. The walls are clad with six inch vertical wood plank siding. The shed roof is clad with standing-seam metal. The Dutch doors are hinged wood planks with diagonal bracing. The windows are six-pane wood awning sashes. The interior of the building is unfinished with an earthen floor.

Silo, ca. 1920

The silo, constructed ca. 1920, is of glazed hollow-tile construction and rests on a poured concrete pad. The silo has a hipped roof clad with standing-seam metal. An enclosed metal ladder is located on the north façade.

Garage, ca. 1980

The garage is of modern construction.

Tenant House #1, ca. 1910

Maryland Historical Trust

Maryland Inventory of Historic Properties Form

Inventory No. T-385

Chenar Farm
Continuation Sheet

Number 7 Page 3

Tenant house #1, constructed ca. 1910, is a one-and-a-half story wood frame structure with a hall-parlor plan. According to a past caretaker, the building was the original main house for the property and was moved to this location ca. 1922 to make room for the construction of the current main residence. The building rests on a continuous concrete masonry unit foundation. The building is clad with aluminum siding. The side gable roof is clad with asphalt shingles and has a paired gable roof dormer on the front façade. The central entry door is flanked by paired nine-over-one wood sashes. The windows are a combination of nine-over-one, eight-over-one, and six-over-one wood sashes. A curved bay window is located on the west façade. The building has two interior brick masonry chimneys. The integral front porch has four square wood columns and a wood plank floor. The rear porch has been enclosed with screening. The interior was not accessible at the time of the survey.

Gas House, ca. 1922

A one-story octagonal wood frame gas house, constructed ca. 1922, with an undivided interior plan is located to the rear of tenant house #1. The building encloses a brick lined pit. The exterior walls and conical roof are clad with wood shingles. The upper portions of the walls are louvered wood panels. The door is a hinged plywood panel.

Tenant House #2, ca. 1930

Tenant house #2, constructed ca. 1930, is a one-story wood frame structure with a hall-parlor plan. The building rests on a poured concrete pier foundation with plywood panels infilling the space between piers. The building is clad with asbestos shingles, embossed with a wood texture. The broken side gable roof is clad with asphalt shingles. The hinged two panel four-pane wood entry door is offset. The windows are paired six-over-one wood sashes. The building has a central brick masonry chimney. The integral front porch has four square wood columns and a wood plank floor. The interior was not accessible at the time of the survey.

Machinery Shed, date unknown

A machinery shed is located to the east of tenant house #2 and faces southwest. It is three bays wide and is of timber frame construction with an open southwest façade. The shed rests on a combination pier and continuous poured concrete foundation. The walls are clad with vertical wood planks. The offset side gable roof is clad with standing-seam metal. There are no doors or windows. The interior of the building is unfinished with an earthen floor.

Tenant House #3, ca. 1890

Tenant house #3, constructed ca. 1890, is a two-story wood frame structure with a three room shotgun plan. The building rests on a continuous brick masonry foundation. The building is clad with aluminum siding. The front-gable roof is clad with asphalt shingles. The hinged four panel wood entry door is offset. The windows are six-over-six wood sashes. The building has two central brick masonry chimneys. The front porch has a wood plank floor, three turned wood columns and hipped roof clad with asphalt shingles. The interior was not accessible at the time of the survey.

8. Significance

Inventory No. T-385

Period	Areas of Significance	Check and justify below		
<input type="checkbox"/> 1600-1699	<input checked="" type="checkbox"/> agriculture	<input type="checkbox"/> economics	<input type="checkbox"/> health/medicine	<input type="checkbox"/> performing arts
<input type="checkbox"/> 1700-1799	<input type="checkbox"/> archeology	<input type="checkbox"/> education	<input type="checkbox"/> industry	<input type="checkbox"/> philosophy
<input checked="" type="checkbox"/> 1800-1899	<input checked="" type="checkbox"/> architecture	<input type="checkbox"/> engineering	<input type="checkbox"/> invention	<input type="checkbox"/> politics/government
<input checked="" type="checkbox"/> 1900-1999	<input type="checkbox"/> art	<input type="checkbox"/> entertainment/ recreation	<input checked="" type="checkbox"/> landscape architecture	<input type="checkbox"/> religion
<input type="checkbox"/> 2000-	<input type="checkbox"/> commerce	<input type="checkbox"/> ethnic heritage	<input type="checkbox"/> law	<input type="checkbox"/> science
	<input type="checkbox"/> communications	<input type="checkbox"/> exploration/ settlement	<input type="checkbox"/> literature	<input type="checkbox"/> social history
	<input type="checkbox"/> community planning		<input type="checkbox"/> maritime history	<input type="checkbox"/> transportation
	<input type="checkbox"/> conservation		<input type="checkbox"/> military	<input type="checkbox"/> other: _____

Specific dates 1914-1920; 1920-1939

Architect/Builder J. Franklin Meehan & Son, landscape architect; Extension Service, University of Maryland, Division of Agricultural Engineering

Construction dates ca. 1910, 1922-23

Evaluation for:

National Register

Maryland Register

not evaluated

Prepare a one-paragraph summary statement of significance addressing applicable criteria, followed by a narrative discussion of the history of the resource and its context. (For compliance projects, complete evaluation on a DOE Form – see manual.)

Summary Statement of Significance

Chenar Farm represents the area of Agriculture between the years 1910 to 1925. The collection of agricultural buildings at Chenar Farm is associated with the historically important dairy industry in Talbot County and the property as a whole is associated with the historically important trend of the gentleman farmer in the county. This coincides with the rise and development of the dairy industry and the development of model farms and country estates owned by wealthy immigrants to Talbot County during the World War I (1914-1920) and the Post-War Recession, the Great Depression, and the New Deal (1920-1939) agricultural periods in Talbot County's history. The property retains several buildings that display the characteristics and building types associated with a high-end dairy operation in Talbot County during these periods.

Historical Background

The property known as Chenar Farm, also known variously as "Bennett's Neglect," "Mackay Farm," and "Sycamores," was purchased by James M. and Lida A. Cowgill in 1891 from Sarah A. Mackey, F. Eugenia Smith, and her husband, Sidney W. Smith. The Cowgills sold the property to Winfield Scott Way and his wife Kate A. in 1908, who owned the property until 1914 when it was purchased by Louis A. and Amanda J. Hazard. The Hazards sold the farm to Ernst Puttkammer in 1917. Henry F. DePuy purchased the property from Ernst Puttkammer and his wife in 1919 and began construction of the house, grounds, and agricultural buildings found on the property today. Mr. DePuy utilized earlier residences remaining on the property as tenant houses. The trustee of the DePuy Estate sold the property to Lela Bartlett Hughes in 1925. The property has remained within the Hughes family since that time. The property is currently an active grain farm with tenants, dairy operations ceased ca. 1945.

9. Major Bibliographical References

Inventory No. T-385'

- Lanier, Gabrielle M. and Bernard L. Herman. *Everyday Architecture of the Mid-Atlantic: Looking at Buildings and Landscapes*. Baltimore: The Johns Hopkins University Press, 1997.
- Nobel, Allen G. and Richard K. Cleek. *The Old Barn Book*. New Brunswick, N.J.: Rutgers University Press, 1997.
- Rawson, Richard. *Old Barn Plans*. New York: Bonanza Books, 1979.
- Talbot County Land Records
- Whitaker, James H. *Agricultural Buildings and Structures*. Reston, Va.: Reston Publishing Co., 1979.

10. Geographical Data

Acreege of surveyed property 95.50
Acreege of historical setting 95.50
Quadrangle name St. Michaels, MD Quadrangle scale: 1: 24,000

Verbal boundary description and justification

The boundary of the surveyed property is marked as current boundary as described on Talbot County Tax Map 24, Grid 11, Parcel 37. The existing parcel portion is concurrent with the historic setting, and includes character-defining resources and setting which relate to the property's construction and evolution.

11. Form Prepared by


name/title	Amy V. Barnes, Architectural Historian		
organization	URS Corporation	date	12-08-03
street & number	7101 Wisconsin Avenue, Suite 700	telephone	301.652.2215
city or town	Bethesda	state	MD 20814

The Maryland Inventory of Historic Properties was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.


return to: Maryland Historical Trust
DHCD/DHCP
100 Community Place
Crownsville, MD 21032-2023
410-514-7600

T-385
Chenar Farm
9284 Chenar Farm Road
Talbot County
Site Plan - 1923

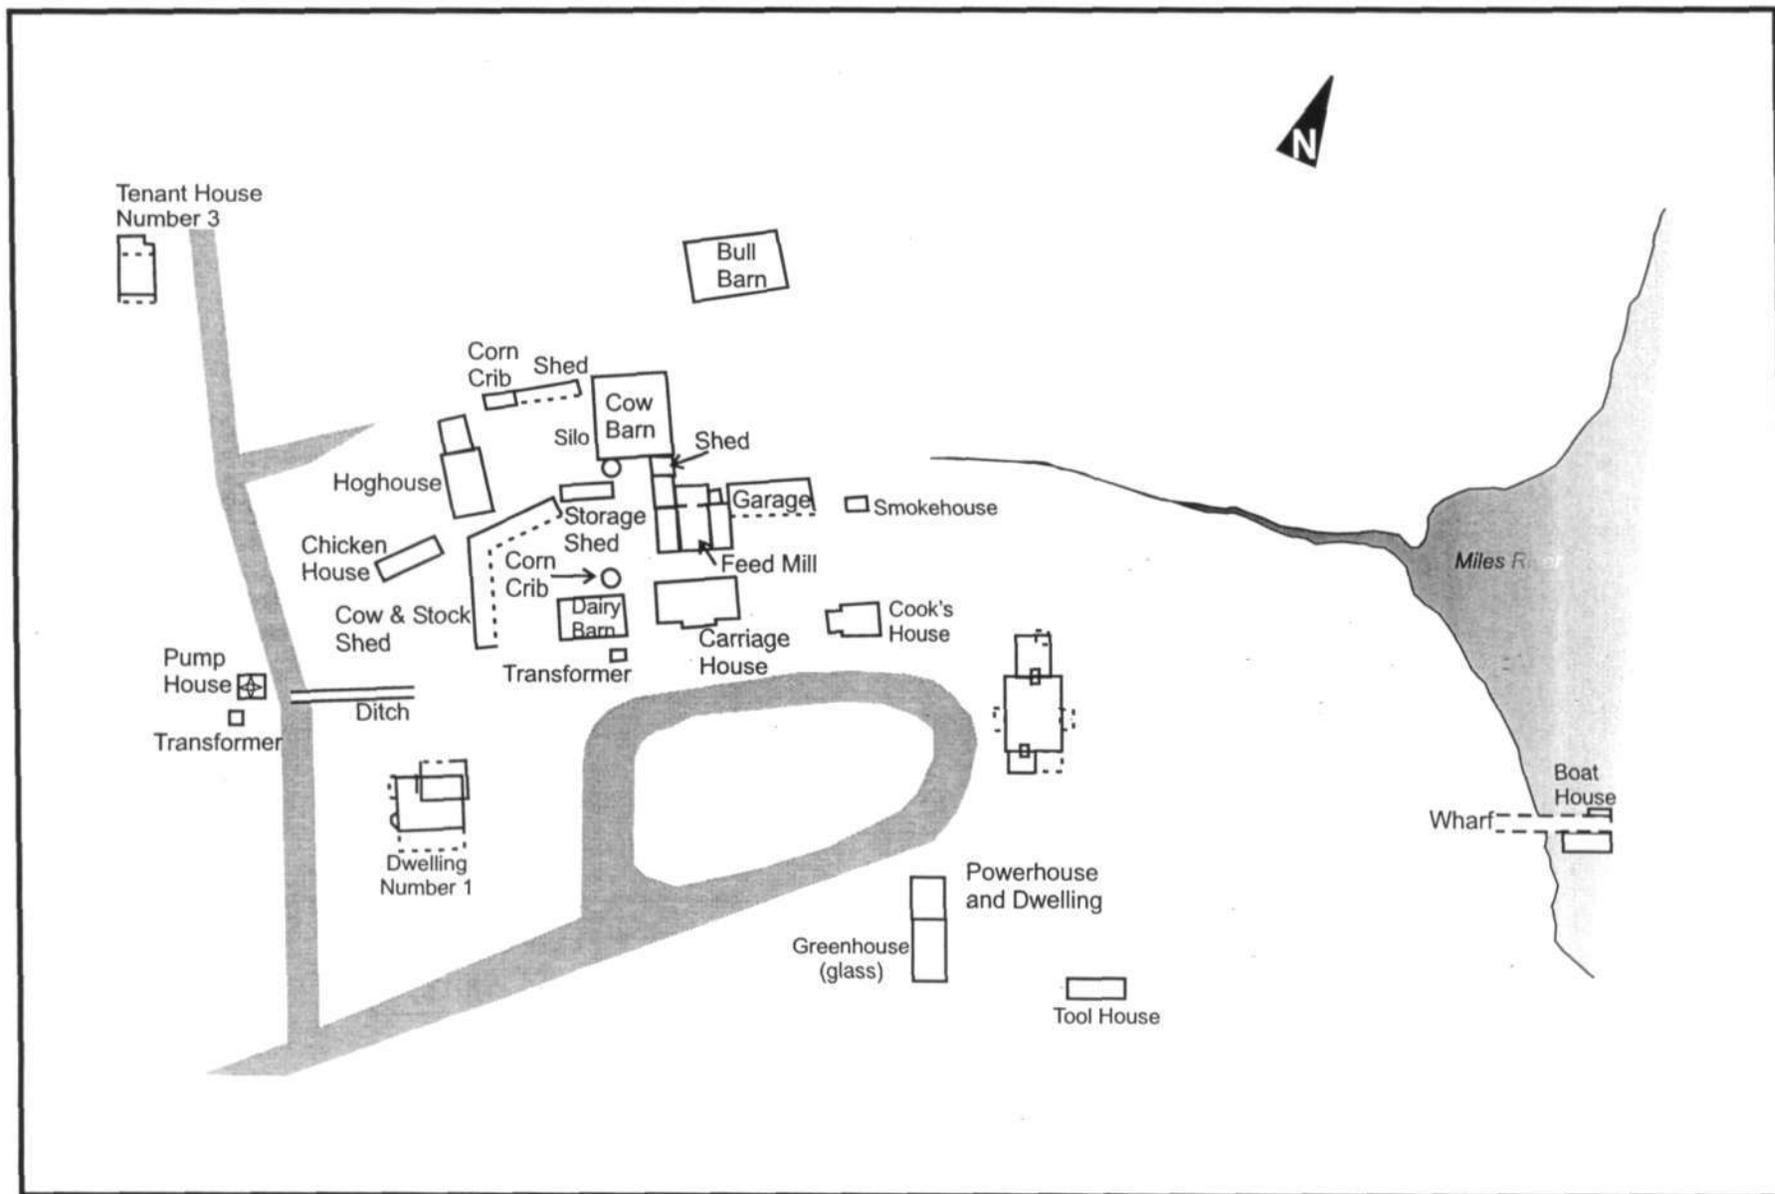



T-385-

T-385
Chenar Farm
9284 Chenar Farm Road
Talbot County
Site Plan - 1935

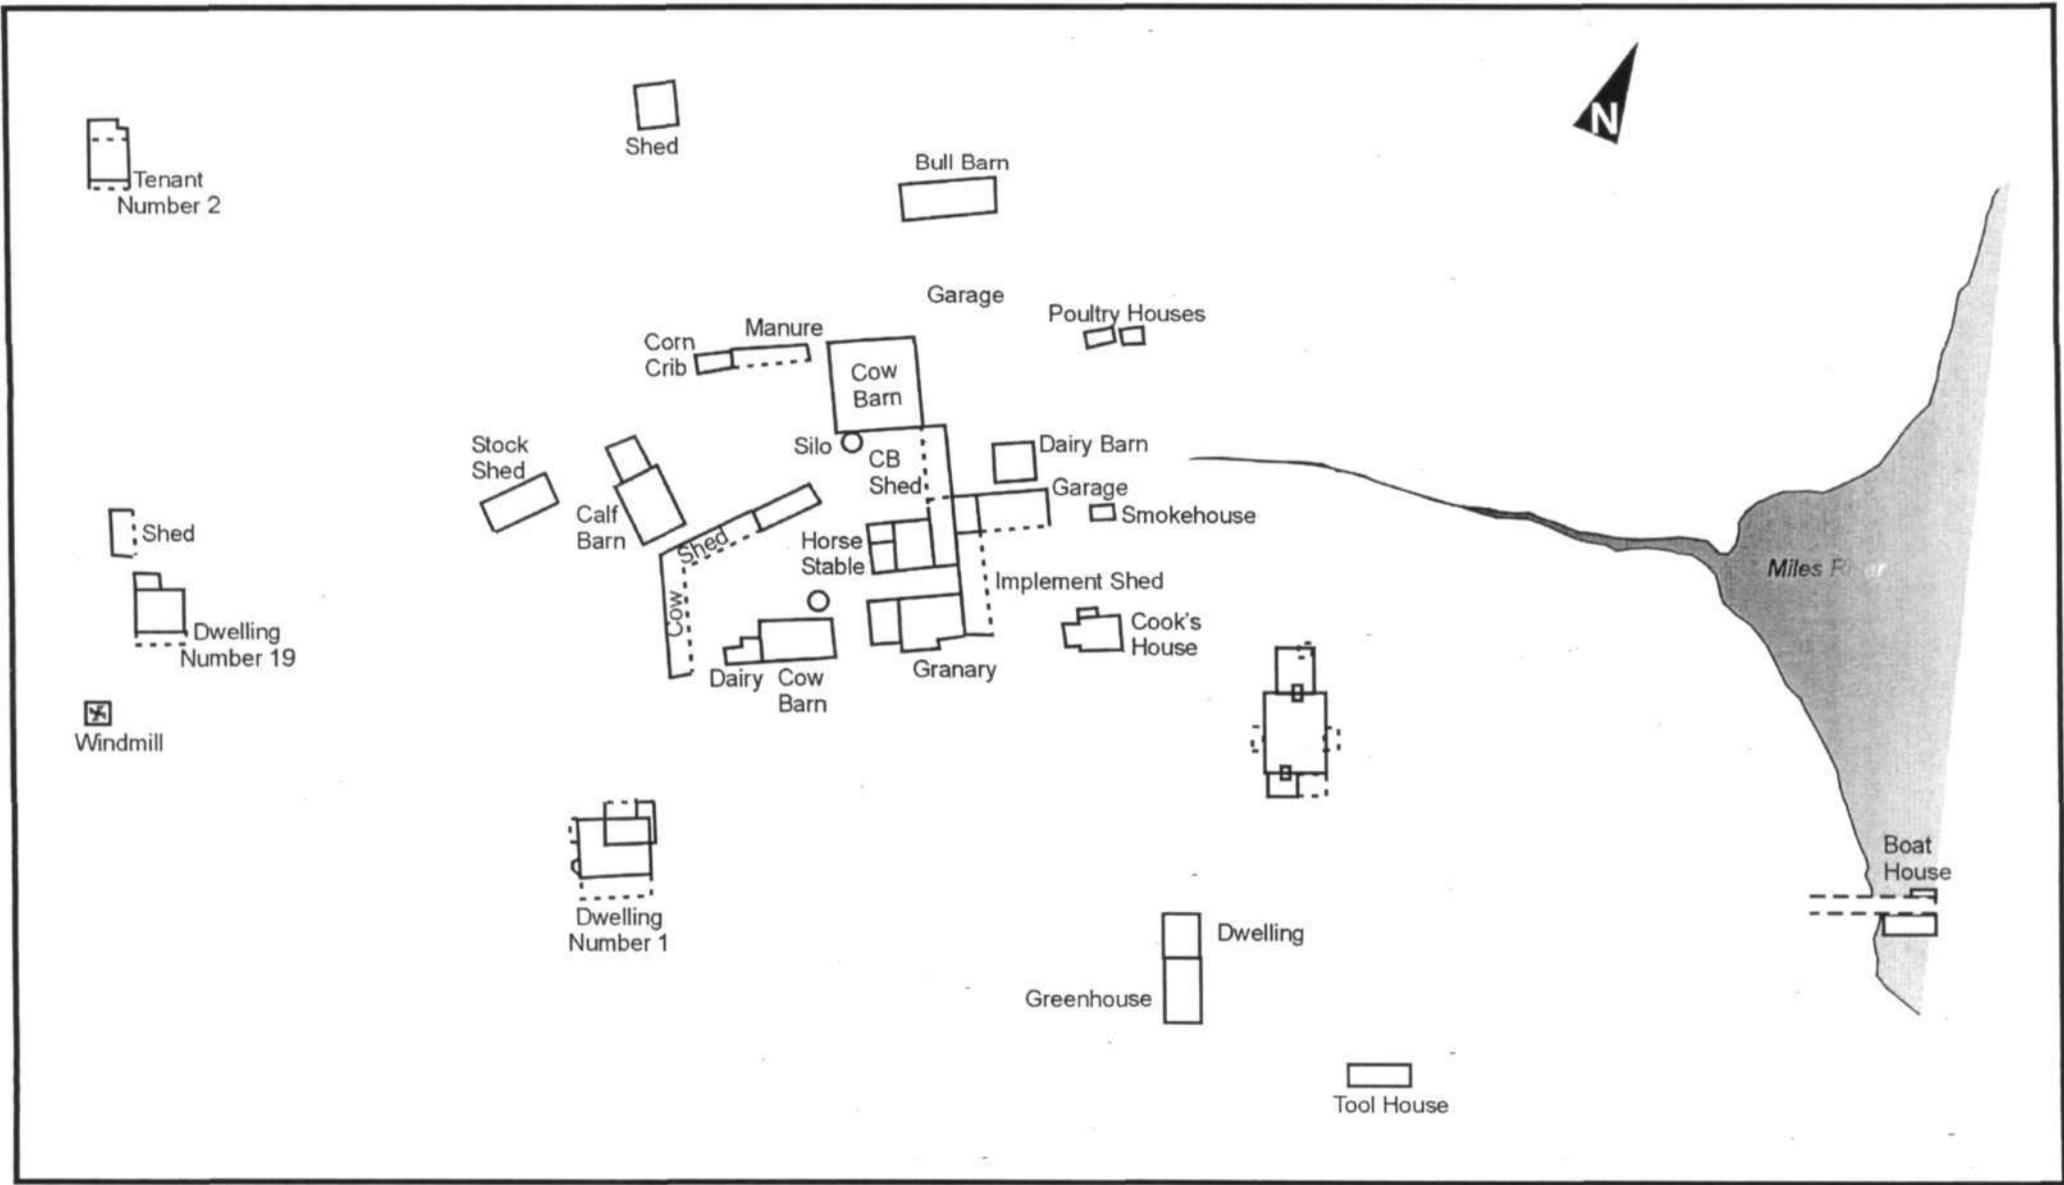


T-385
Chenar Farm
9284 Chenar Farm Road
Talbot County
Site Plan - 1943

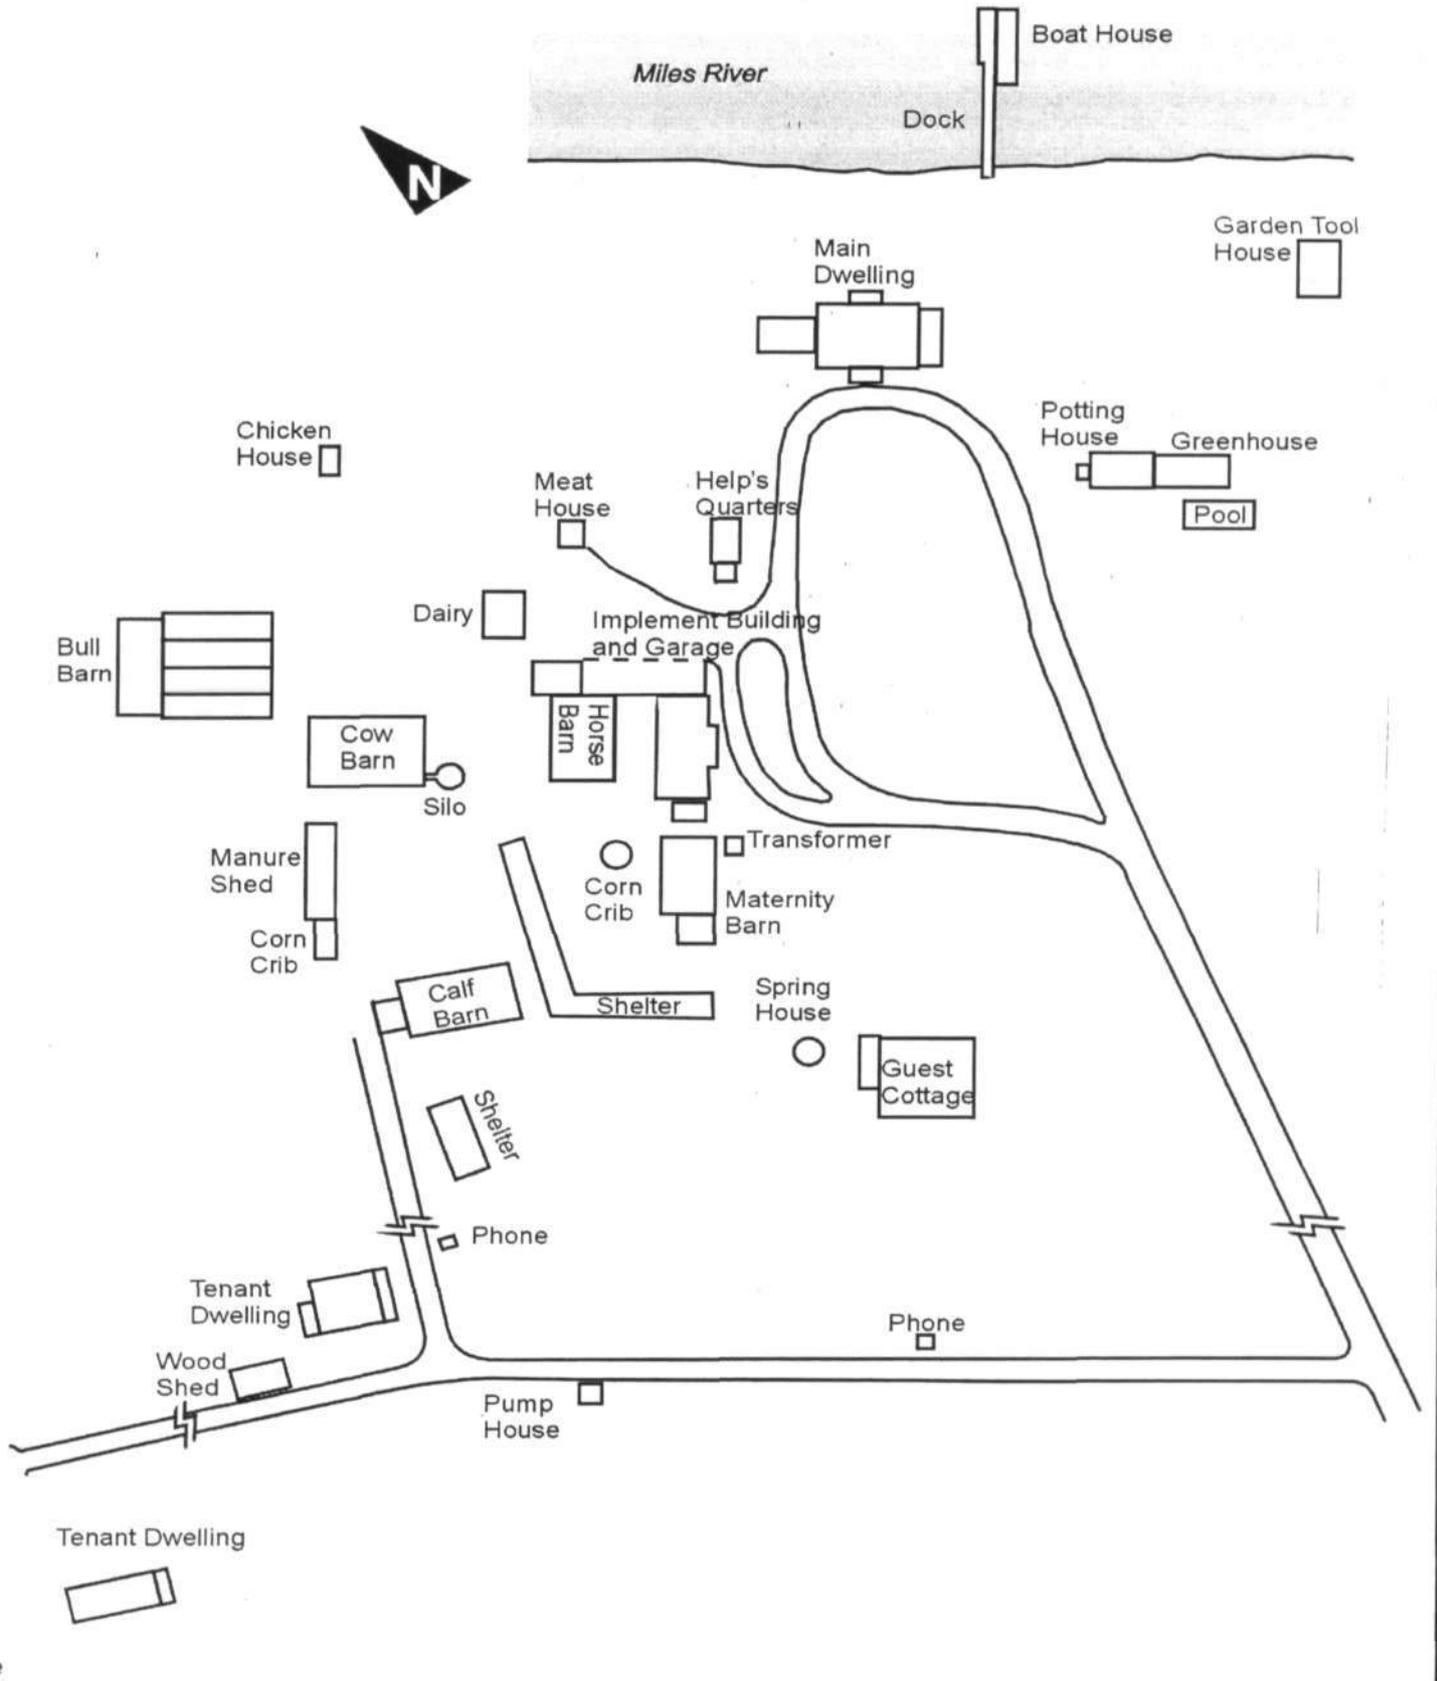


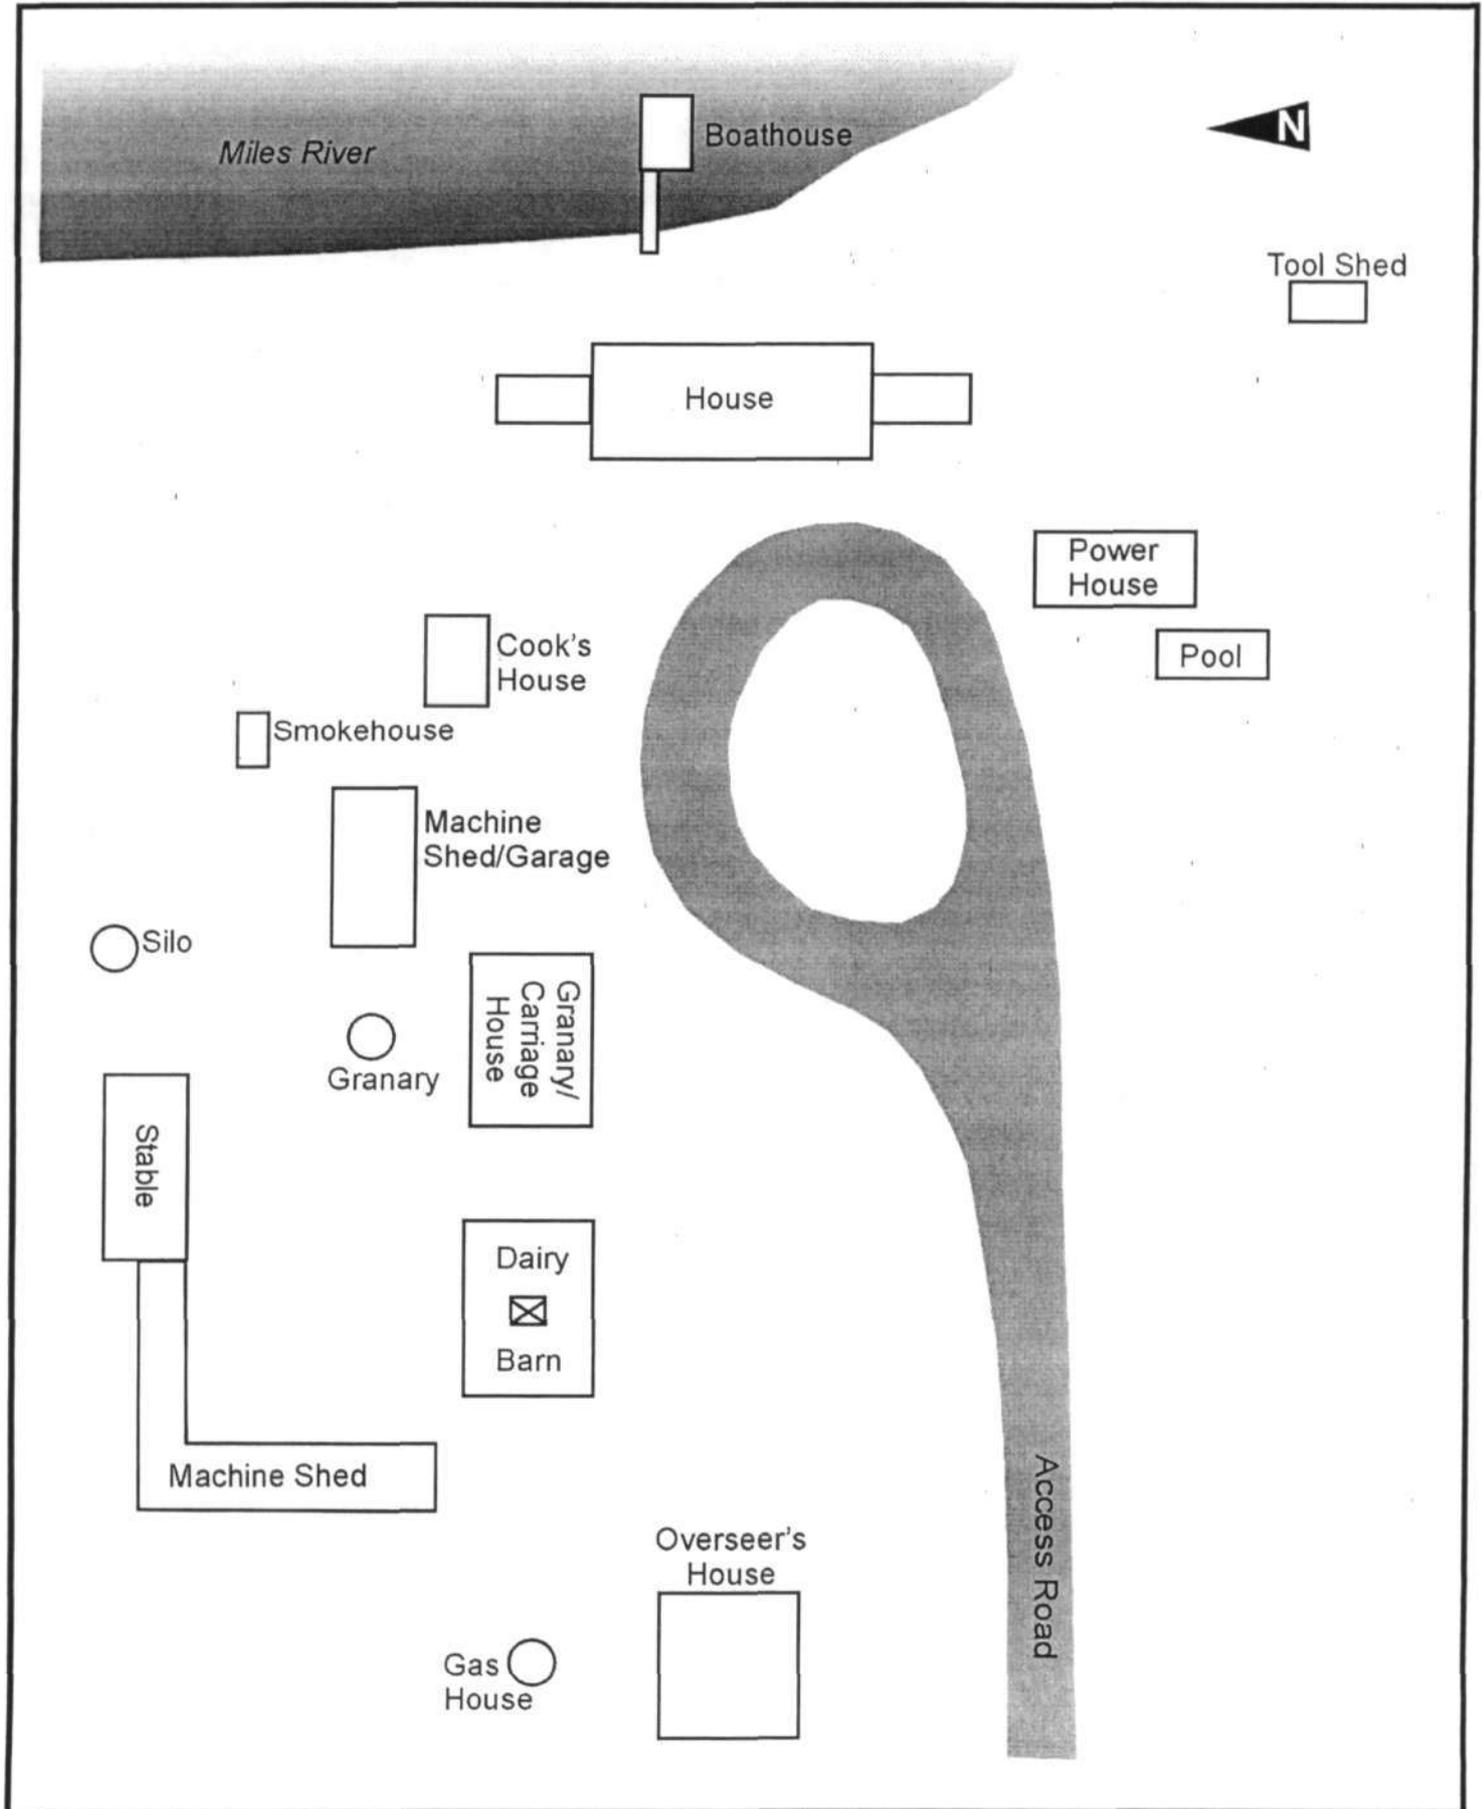


T-385
Chenar Farm
9284 Chenar Farm Road
Talbot County
Machine Shed - 2003

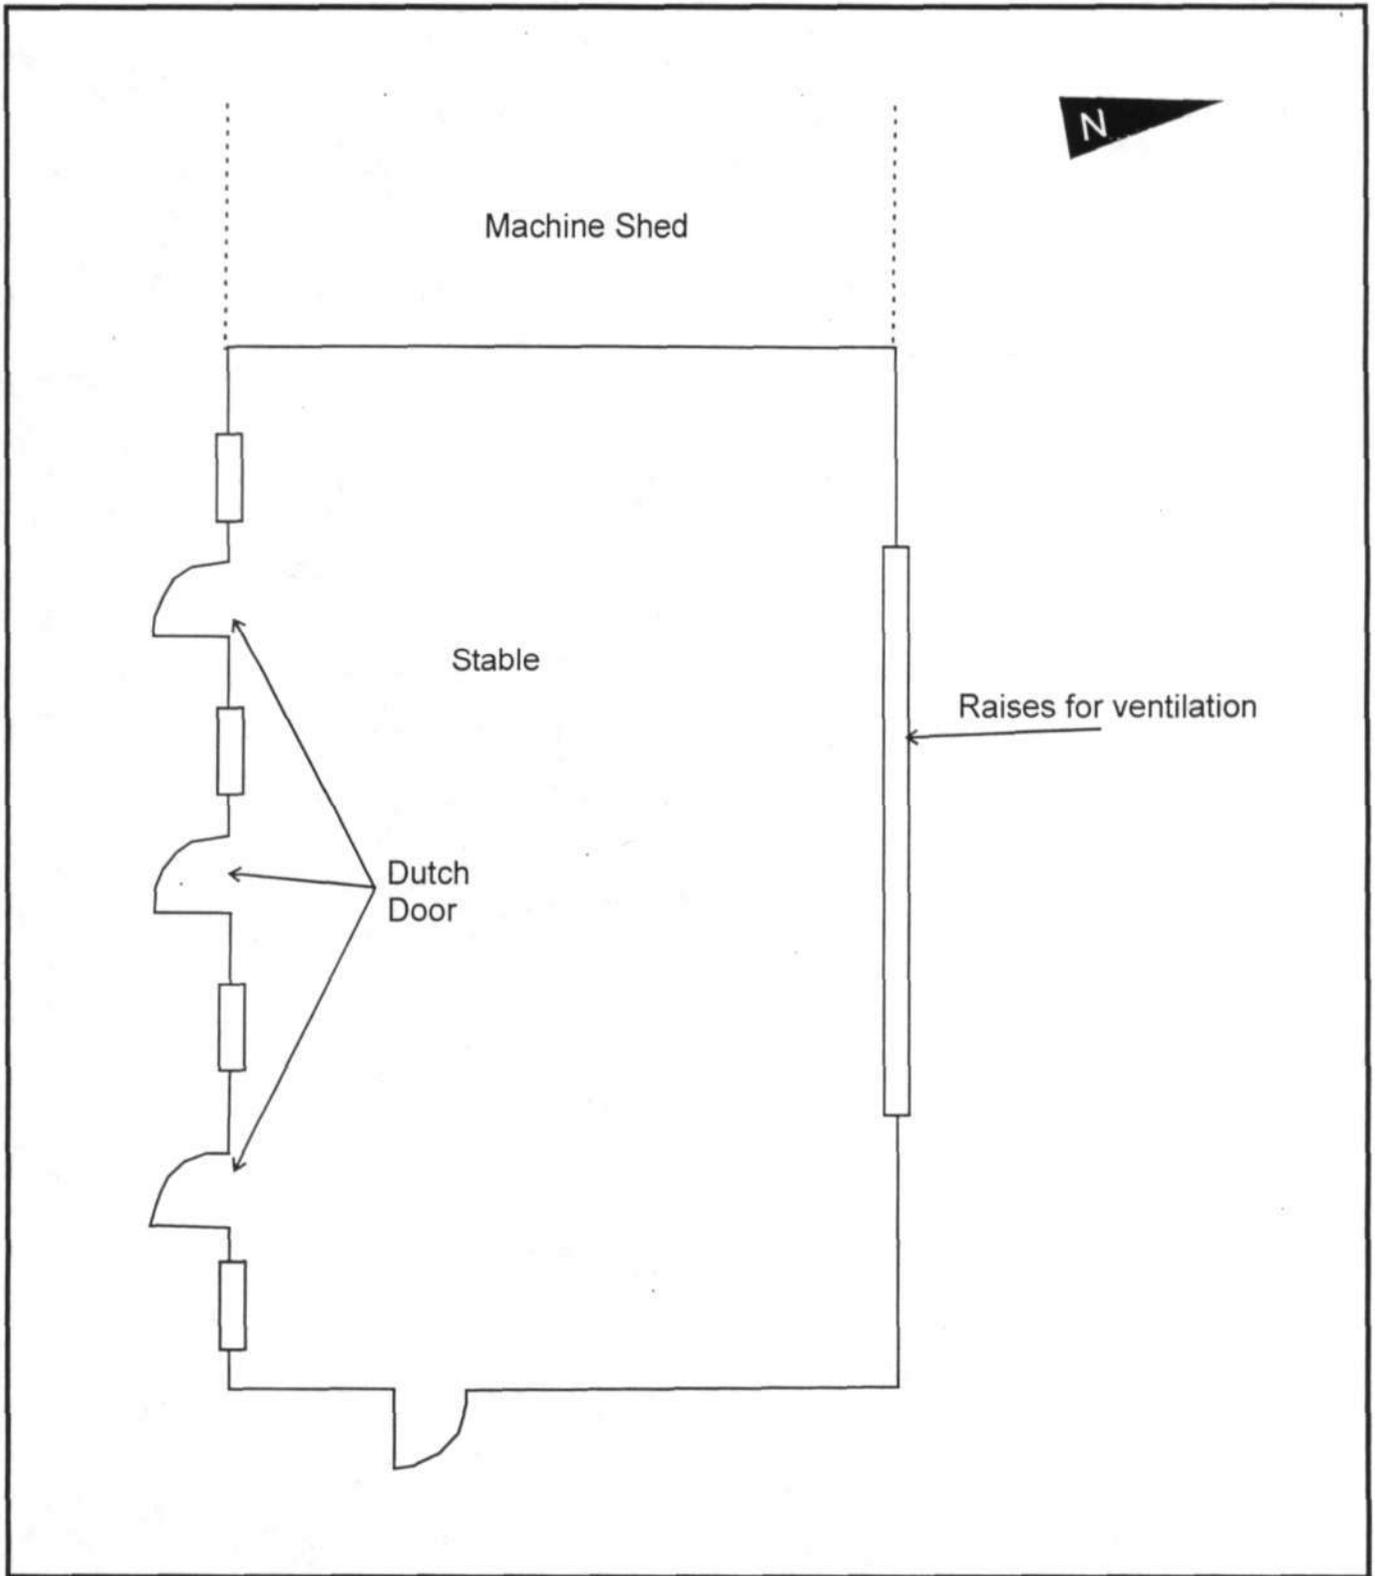

T-385
Chenar Farm
9284 Chenar Farm Road
Talbot County
Powerhouse - 2003

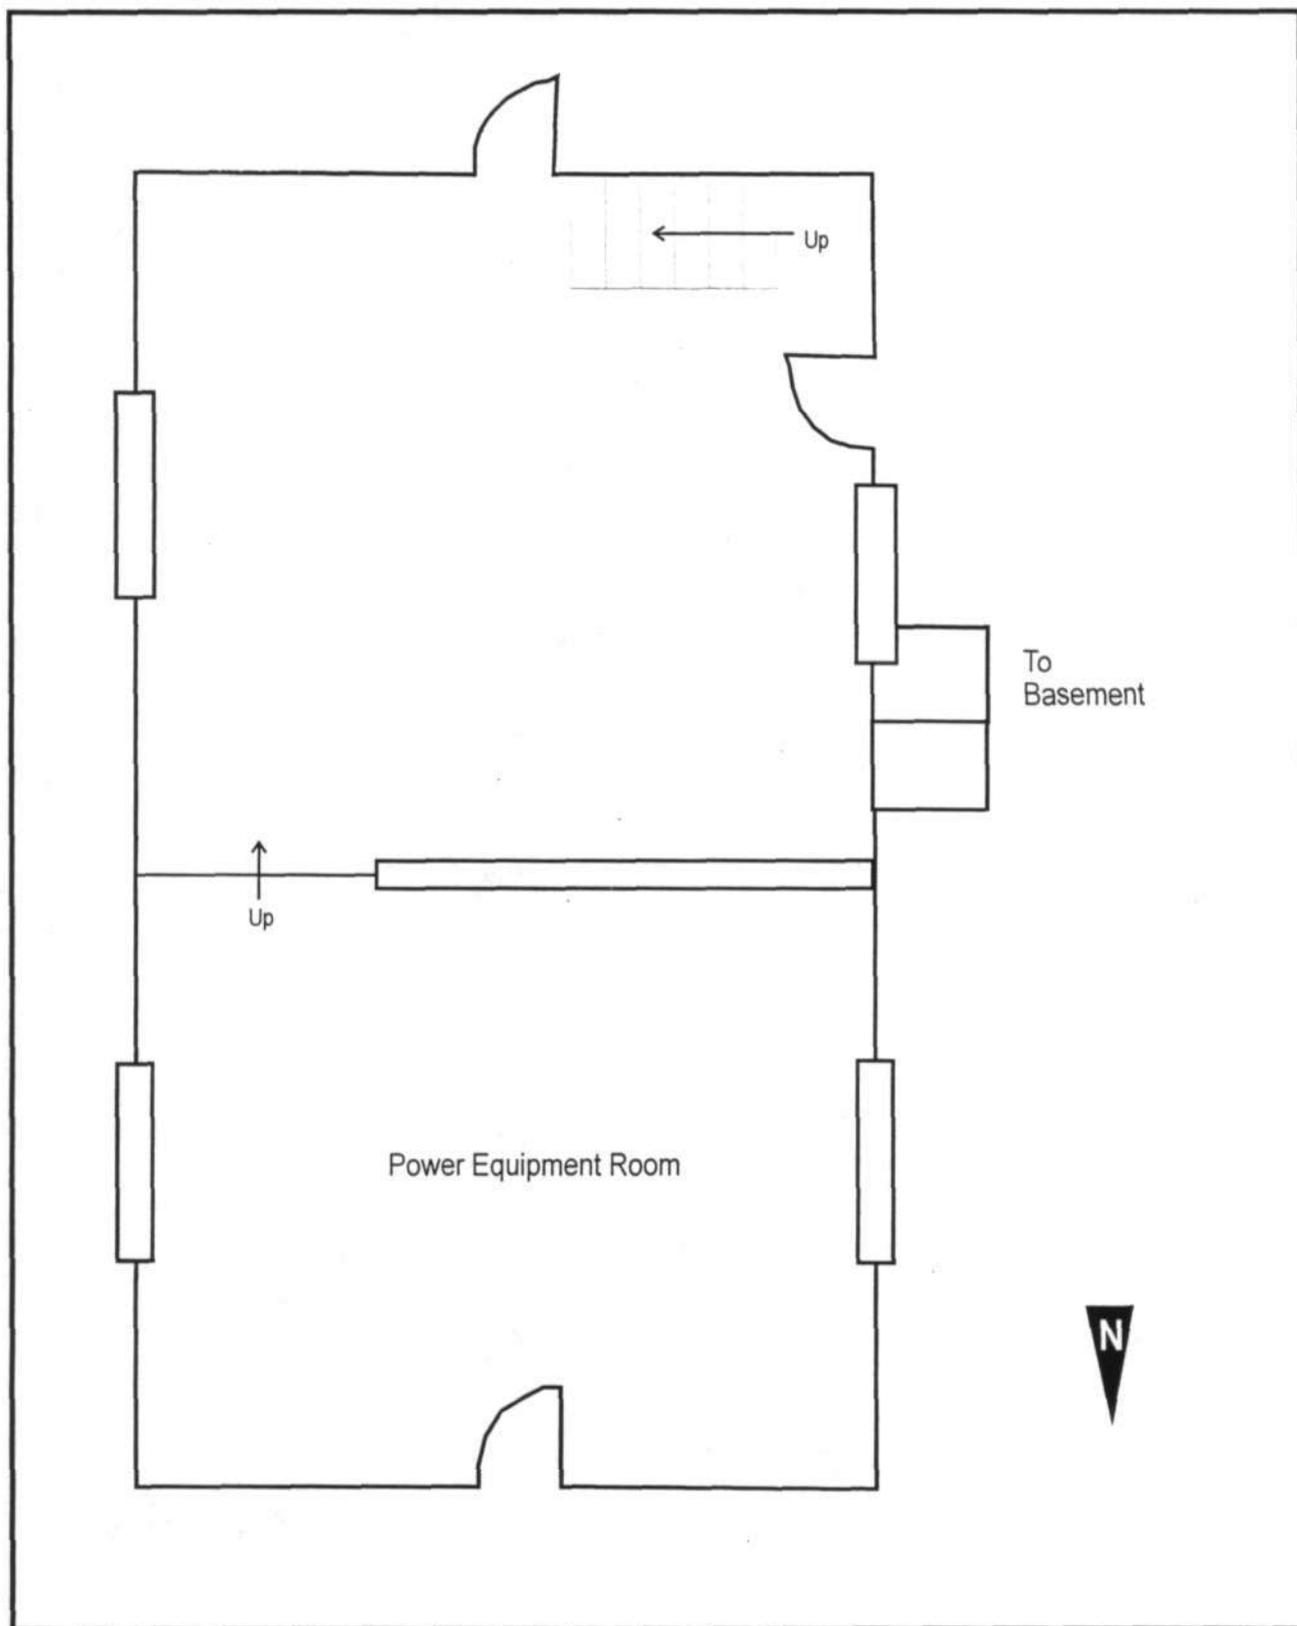

T-385
Chenar Farm
St. Michaels, MD USGS Quad (1: 24,000)

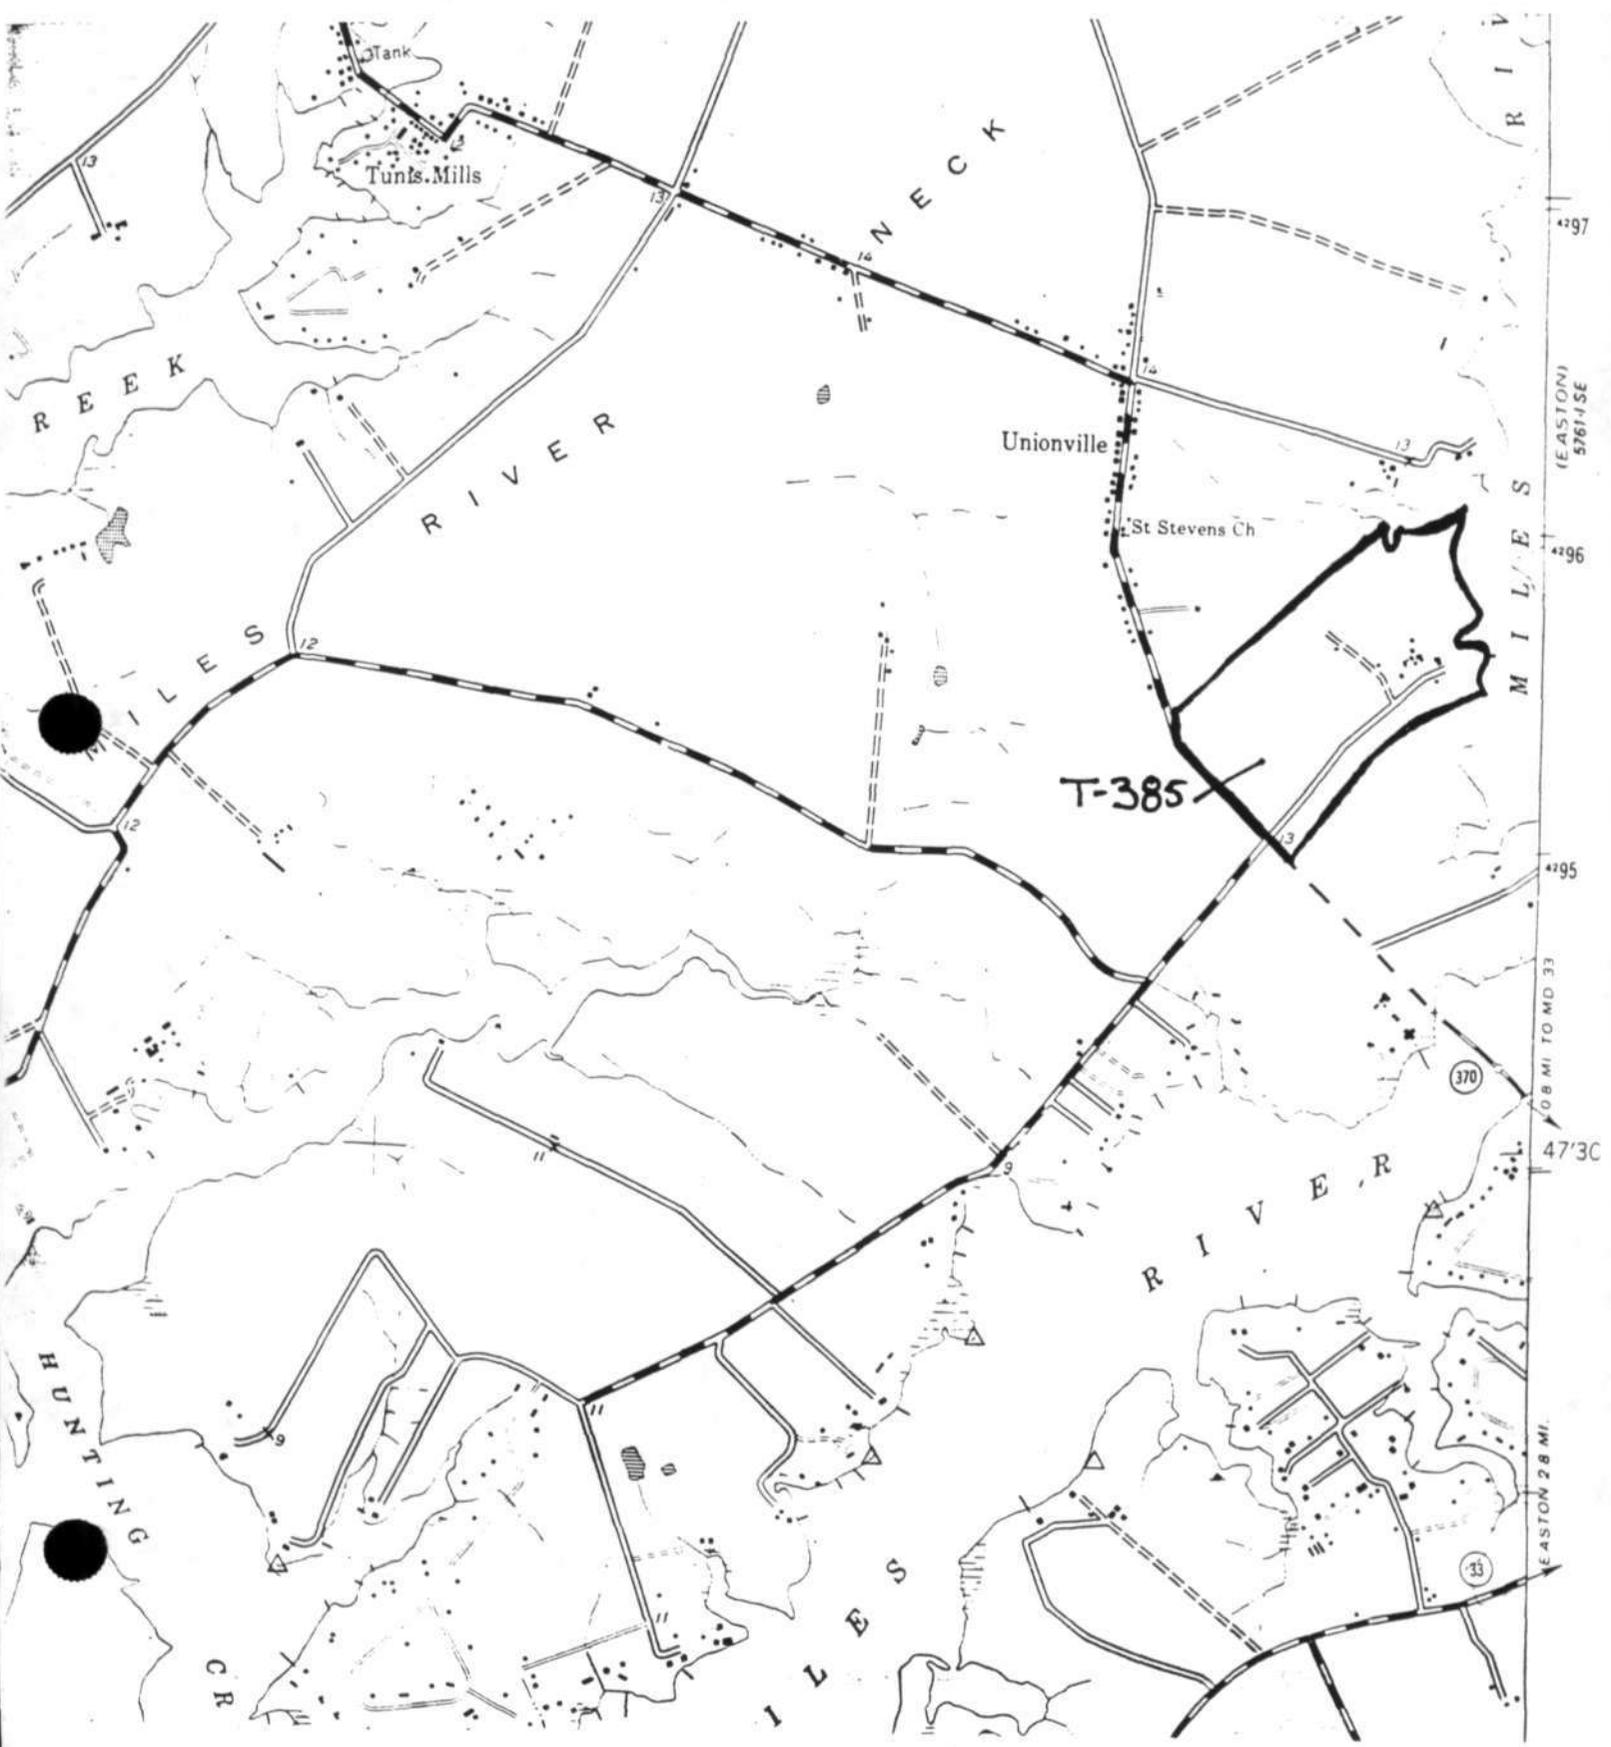



T-385

Cheney Farm
Talbot Co. MD

A BARNES

7/30/03

MD SHPO

HOUSE (FRONT) SW

1/52



T-385

Chenar Farm

Talbot Co. MD

A BARNES

7/30/03

MDSHPO

House looking S

2/52



T-385

Chenar Farm
Talbot Co. MD

A BARNES

7/30/03

MD SHPO

House Looking S

3/52



T-385

Chenar Farm
Talbot Co. MD

A BARNES

7/30/03

MDSHPO

HOUSE REAR LOOK NW

4152



T-385

Chenoweth Farm

Talbot Co, MD

A BARNES

7/30/03

MD SHPO

House Look NW

5/52



T-385

Chenar Farm

Talbot Co. MD

A. BARNES

17/30/03

MD SHPO

House looking N

6/52



T-385

Chenier Farm

Talbot Co. MD

A BARNES

7/30/03

MD SHPO

house looking N

7/52



T-385

Chenar farm
Talbot Co MD

A. BARNES

7/30/03

MD SHPO

Boat house looking E

8/52



T-385

Chenar Farm

Talbot Co, MD

A BARNES

7/30/03

MD SHPO

Tool shed looking S

9/52



T-385

Chenar Farm

Talbot Co MD

A BARNES

7/30/03

MD SHPO

Power house + green house talk N

10/52



T-385

Chenar Farm
Talbot Co. MD

A BARNES

7/30/03

MD SHPO

Power House + green house look

11/52



T-385

Chenoweth Farm

Talbot Co. MD

A BARNEYS

7/30/03

MD SHPO

FORMAL GARDEN LOOKING W

12/52



T-385

Chunar Farm
Talbot Co. MD

A. BARNES

7/30/03 SS

MD SHPD

House looking E

13/52



T-385

Onenak Farm
Talbot Co, MD

A BARNES

7/30/03

MD SHPO

COOKS HOUSE looking NE

14/52



T-385

Chenak Farm

Talbot Co. MD

A, BARNES

7/30/03

MD SHPO

Cook's House Looking SW

15/52



T-385

Chenar Farm

Talbot Co. MD

A. BARNES

7/30/03

MD SHPO

COOK'S HOUSE looking W

1/16/52



T-385

Chenak Farm
Talbot Co MD
A. BARNES

7/30/03

MD SAPO

Smoke House looking N

17/52



T-385

Chenar FARM

Talbot Co, MD

A BARNES

7/30/03

MD SHPO

Smoke House Looking SE

18/52



T-385

Chenoweth Farm
Talbot Co. MD.

A, BARNES

7/30/03

MD SHPO

Silo Looking NW

19/52



T-385

Chenar FARM

Talbot Co. MD

A. BARNES

7/30/03

MD SHPO

Carriage House

looking for

20/52



T-385

Chenar Farm

Talbot Co. MD

A BARNES

7/30/03

MD SHPO

Carriage House looking NE

21/52



T-385

Chenok FARM
Talbot Co. MD

A BARNES

7/30/03
MD SHPO

Dairy BRN look NW

22/52



T-385

Chenar Farm

Talbot Co, MD

A BARNES

7/30/03

MD SHPO

Carriage house looking N

23/52



T-385

CHENER FARM

Talbot CO. MD

A BARNES

7/30/03

MD SHPO

Carriage House Looking NE

24/52



T-385

Chenar Farm
Talbot Co, MD

A BARNES

7/30/03

MD SHPO

Dairy Barn looking SW

25/52



T-385

Chenak Farm

Talbot Co. MD

A. BARNES

7/30/03

MD SHPO

Dairy BARN looking SE

24/52



T-385

Chunar farm

Talbot Co. MD

A. BARNES

7/30/03

MD SHPO

Dairy barn look j NE

27/52



T-385

Chenae Farm
Talbot Co. MD

A BARNES

+7/30/03

MD SAPO

Metal Corn Crib, looking S

28/52



T-385

Chenar Farm
Talbot Co. MD

A. BARNES

7/30/03

MD SHPO

ANIMAL STORAGE Bldg. Look'g W

29/52



T-385

Chenak Farm
Talbot Co. MD

A. BARNES

7/30/03

MD SHPO

ANIMAL STORAGE BLDG. bkg W

30/52



T-385

Chenax Farm

Talbot Co. MD

A. BARNES

7/30/03

MD SHPO

ANIMAL STORAGE BLDG LOOKING NW

31/52



T-385

Chenar Farm

Talbot Co. MD

A. BARNES

7/30/03

MD SHPD

ANIMAL STORAGE Bldg. Looky SW

32/52



T-385

Chenar Farm
Talbot Co. MD

A BARNES

7/30/03

MD SHPO

ANIMAL storage Bldg. looking SW

33/52



T-385

Chenoweth Farm
Talbot Co MD

A. BARNES

7/30/03

MD SHPO

Silo look SE

34/
52



T-385

Chenar Farm

Talbot Co. MD

A BARNES

A 7/30/03

MP SHPO

ANIMAL STORAGE

35/52



T-385

Chenae Farm

Talbot Co, MD

A BARNES

7/30/03

MD SHPO

Silo (detail) look NE
tile

36/52



T-385

Chenar Farm

Talbot Co, MD

A BARNES

7/30/80

MD SHPO

Dairy Barn look'g W

37/52



T-385

Chenar Farm
Talbot Co, MD

A BARNES

7/30/03

MD SHPO

Tenant House #1 look W

38/52



T-385

Chenar Farm
Talbot Co MD
A BARNES

7/30/03 =

MD SHPO

Tenant House # 1 looking NW
39/52



T-385

Chenar Farm

Talbot Co. MD

A BARNES

11/30/03

MD SHPO

Gas House looking NW

40/52



T-385

Chenar FARM

Talbot Co. MD

A. BARNES

7/30/03

MD SHPO

Tenant House # 1 + GAS HOUSE looking S

4/1/52



T-385

Chenoweth FARM

Talbot Co. MD

A. BARNES

7/30/03

MD SHPO

Tenant House #1 looking S

42/52



T-385

Chenar Farm
Talbot Co, MD

A BARNES

7/30/03

MD SHPO

Roof BRACKET on Tenent House #1 Looking S

43/52



T-385

Chenar Farm
Talbot Co, MD

A BARNES

7/30/03

MD SHPO

Tenant House # 2 / CARE TALKERS HOUSE LOOKING
N

'44/52



T-385

Chenar Farm
Talbot Co. MD

A BARNES

7/30/03
MD SHPO

Tenant House # 2 / CARETAKERS HOUSE Look W

45/52



T-385

Chenak Farm
Talbot Co. MD

A BARNES

7/30/03

MD SHPO

Tenant House #2 looking S

46/52



T-385

Chenak farm
Talbot Co. MD

A BARNES

7/30/03

MDS4PO

Tenant House # 2 looking S

47/52



T-385

Chenak FARM

Talbot Co, MD

A BARNES

7/30/03

MD SHPD

STORAGE SHED LOOKING N

48/52



T-385

Chenae Farm
Talbot Co MD

A BARNES

7/30/03

MD SHPO

DRAINAGE channel look T F

49/52



T-38.5

Chenar Farm

Talbot Co. MD

A BARNES

7/30/03

MD SHPO

Tenant House # 3 looking NW

50152



T-385

Chenak Farm
Talbot Co. MD

A. BARNES

7/30/03

MD SHPO

Tenant House #3 looking S

SI 152



T-385

Chenar Farm
Talbot Co. MD
A₃ BARNES

7/30/03

MD SHPO

Tenant House # 3 lot 7 5H

52/52